

---

## NOTES & ERRATA

**HIGH PERFORMANCE MODEL TRAIN CONTROLLER:** (October 1978, File No. 2/MC/16): Resistor R15, shown as 820 ohms, should be changed to 180 ohms. The 820 ohm resistor shown in error will not permit reliable relay operation.

**CMOS DIE** (April 1979, File No. 3/EG/11): The pin numbers of the 4017 IC were incorrectly shown. Pin 1, shown at top left, should be at bottom right, and pin 16, shown top right, should be at bottom left. There is also an error in the board pattern. Pin 2 of the 4017 is shown connected to pin 3 of 4001B, but should connect to pin 2 of this IC.