

NOTES & ERRATA

Sept. 1984, ETI-1410 Bass Guitar Amp. There were two errors in the mains wiring diagram. Firstly, the active wire should come from the terminal block to the back pin of the fuse holder and not the ring as shown.

The other error is that the mains switch should be wired with the input on the mains side connected to the throw terminals of the switch and not the pole terminal as shown. This is to ensure that with the switch in the off position the only terminals which will be live will be the two inputs, and not the spare set of throw terminals as well.

Neither of these errors will cause the unit to function incorrectly, but the changes should be made for safety reasons.