

NOTES AND ERRATA

LOW NOISE PREAMPLIFIER: (September 1971, File No 1 / PRE / 26) Constructors who have coupled low impedance cartridges to the input via an impedance step-up transformer have found the unit deficient in bass response. This unit requires a low source impedance in order that the feedback loop will function correctly. To solve the problem remove the 1M resistor (R2) and experiment with the values of R1, C2 and C3.