

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: APM950

No. 9


Subject: Repair of Loose Speaker Cabinets **Date:** February 25, 1988

Symptom:
(54)

Speaker rattle because of mechanical vibration.

Solution:

Remove the woofer frame and woofer. Apply an even bead of white glue (EVA), wood glue or heated glue to the joint inside the cabinet where the back board and wrap join (refer to drawing). Reinstall woofer and frame. Let cabinet rest in horizontal position twelve hours before moving or playing.

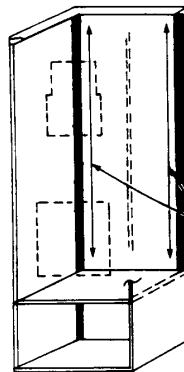

APPLY A BAND OF GLUE ALONG
THOSE LINES

CSA-13 Speakers

Reference:

PRINTED IN U.S.A.
CSA-13288-7