

# TV Products Service Bulletin

CSV-1

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** KP-53XBR45, KP-61XBR48

**No.** 285

**Subject:** Jittering P in P or P & P picture

**Date:** February 15, 1996

**Symptom:**  
(237)

If customer should experience intermittent jittering P in P (Picture in picture) or P & P (picture and Picture). Please perform the following circuit change on AB board.

**Solution:** Step 1: Cut foil pattern as illustrated below:

Step 2: Add the following wire between Pin 10a of CN6007 and R7385(Pin 5 of IC7310 side).

REF	DESCRIPTION
INSULATED WIRE	AWG 24 OR 26, 4 INCH LENGTH

