

McIntosh

MODEL NUMBER: C 8, C 11, C 22

DATE: APRIL 1965


MODIFICATION: Replace the selenium rectifier with silicon rectifiers. These silicon rectifiers have much longer life.

DESCRIPTION: The original selenium rectifier in the C 8 is replaced by two (2) silicon rectifiers; the original selenium rectifier in the C 11 and C 22 is replaced by four (4) silicon rectifiers. The rectifiers are McIntosh part number 070-014, or any 50 PIV 750 MA rectifiers.


PROCEDURE: The selenium rectifier is replaced by a terminal strip and the new silicon rectifiers are installed as shown in the following diagrams.

NOTE THAT TERMINAL STRIPS ARE REQUIRED

C 8

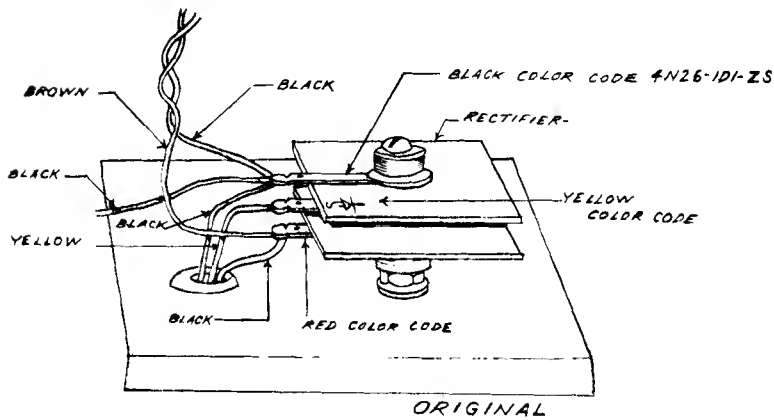

RECTIFIERS

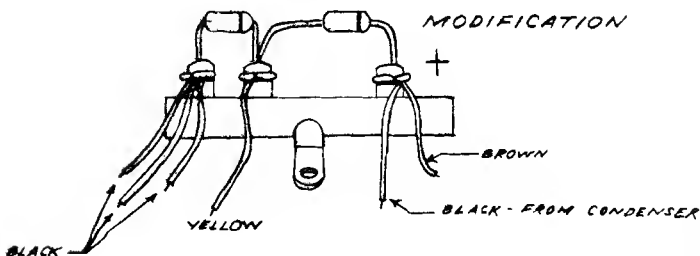

C 11, C 22

