

Panasonic

PDP

Pictures of Symptoms Caused by Defective Plasma TV Panels



Warning

This service information is designed for experienced repair technicians only and is not designed for use by the general public. It does not contain warnings or cautions to advise non-technical individuals of potential dangers in attempting to service a product. Products powered by electricity should be serviced or repaired only by experienced professional technicians. Any attempt to service or repair the product or products dealt with in this service information by anyone else could result in serious injury or death.

Prepared by
Cesar Perdomo
Panasonic Service and Technology Company
National Training

Copyright © 2007 by Panasonic Service and Technology Company
All rights reserved. Unauthorized copying and distribution is a violation of law.

Symptoms normally caused by defective Panels



Figure1



Figure 2

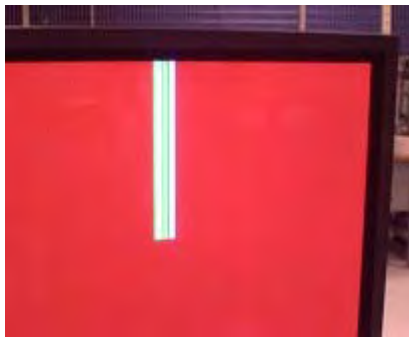


Figure 3



Figure 4

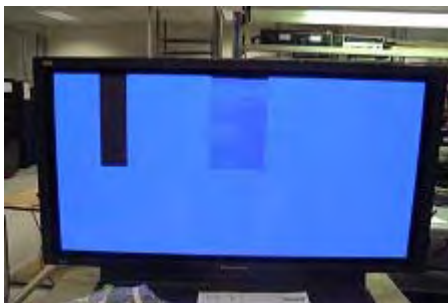


Figure 5



Figure 6

Table 1



Figure 7



Figure 8



Figure 9

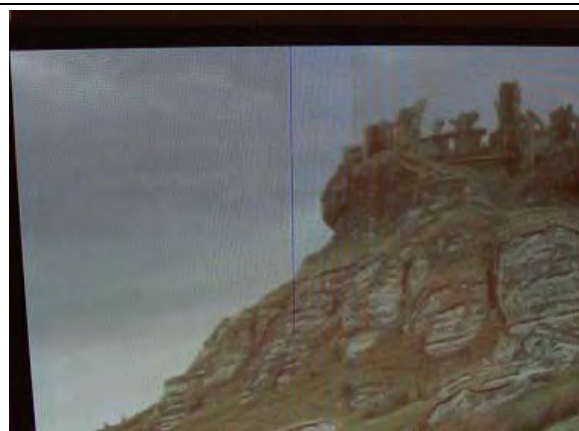


Figure 10



Figure 11



Figure 12

Table 2



Figure 13



Figure 14



Figure 15



Figure 16



Figure 17



Figure 18

Table 3

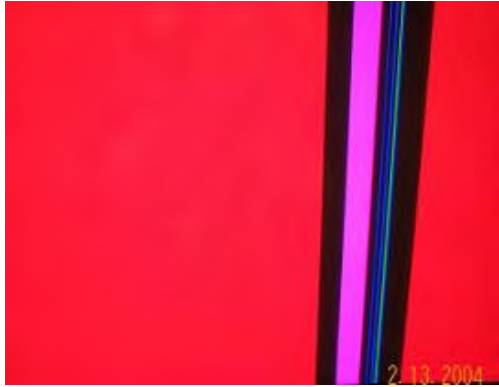


Figure 19



Figure 20



Figure 21

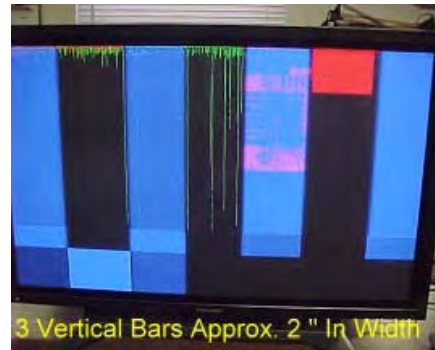


Figure 22



Figure 23



Figure 24

Table 4



Figure 25



Figure 26



Figure 27

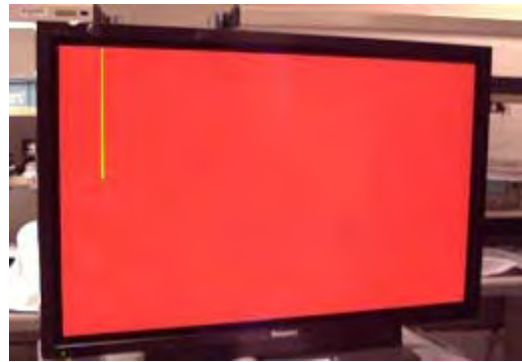


Figure 28

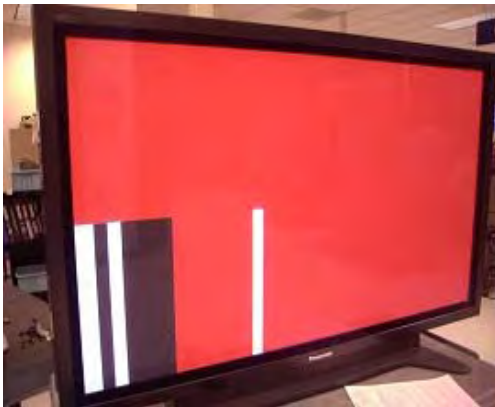


Figure 29

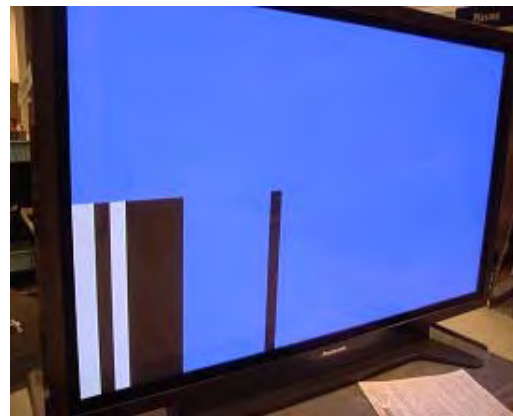


Figure 30

Table 5



Figure 31



Figure 32



Figure 33



Figure 34

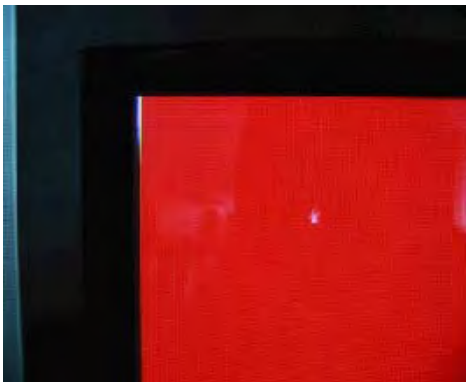


Figure 35



Figure 36

Table 6

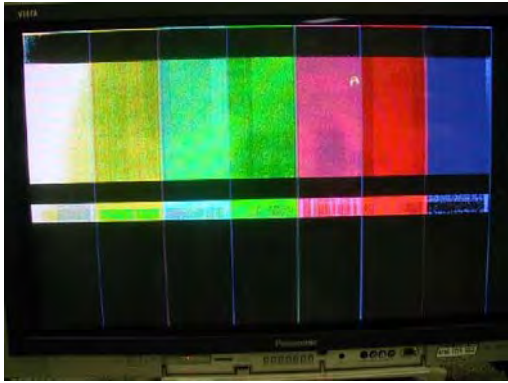


Figure 37



Figure 38

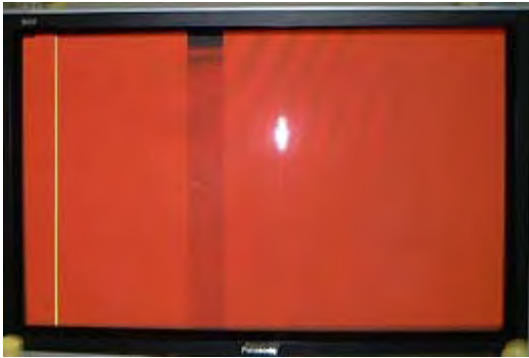


Figure 39



Figure 40

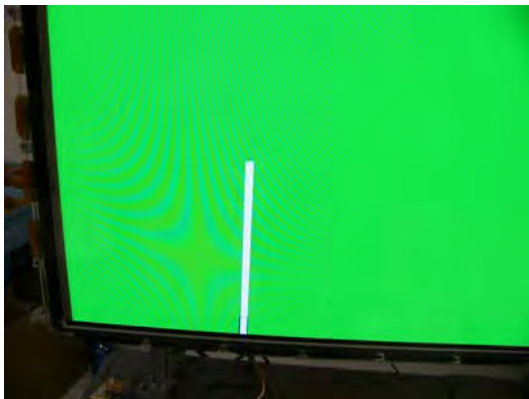


Figure 41

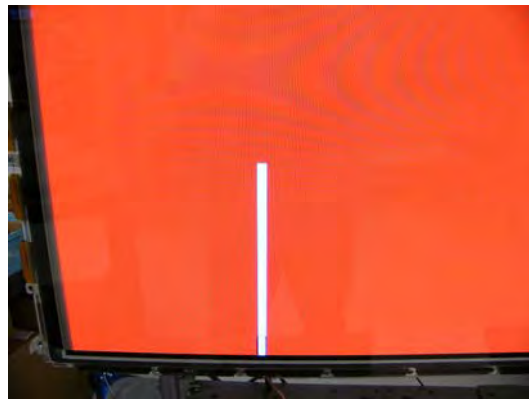


Figure 42

Table 7



Figure 43

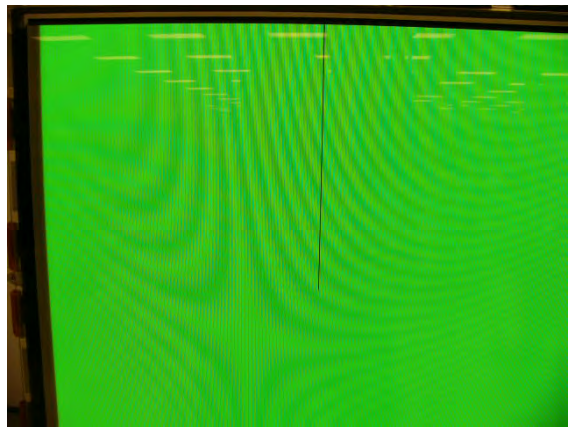


Figure 44

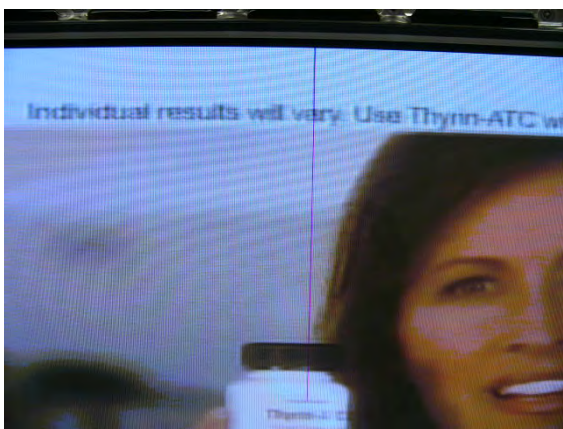


Figure 45

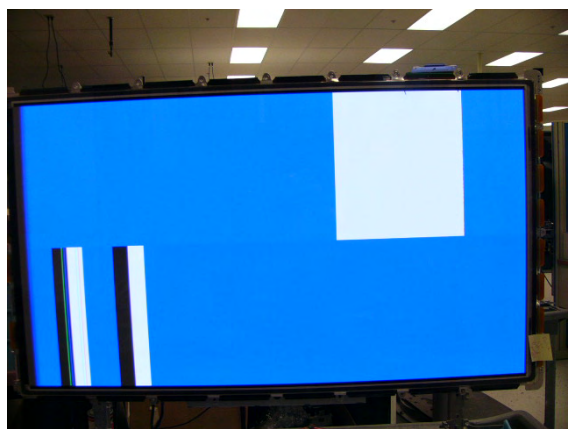


Figure 46

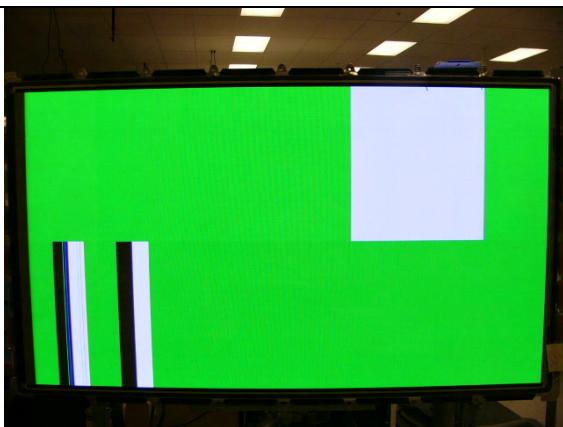


Figure 47

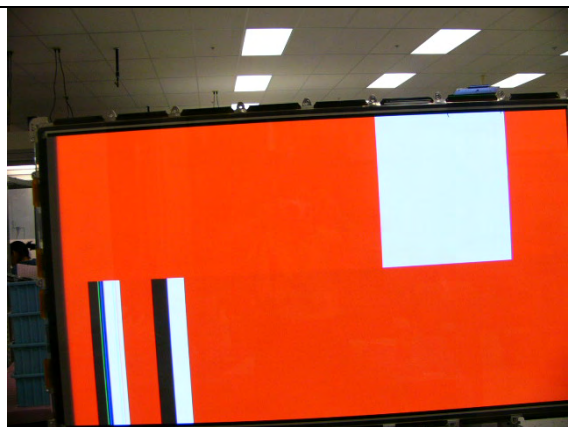


Figure 48

Table 8

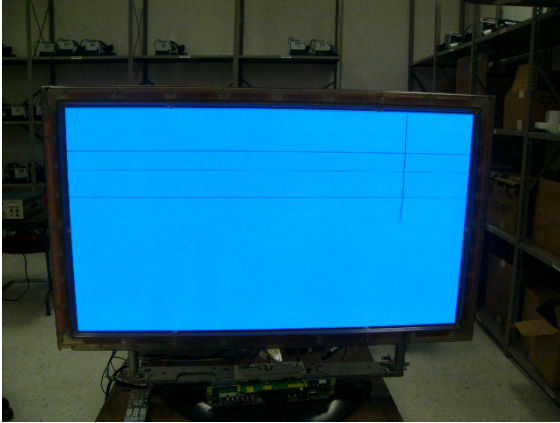


Figure 49

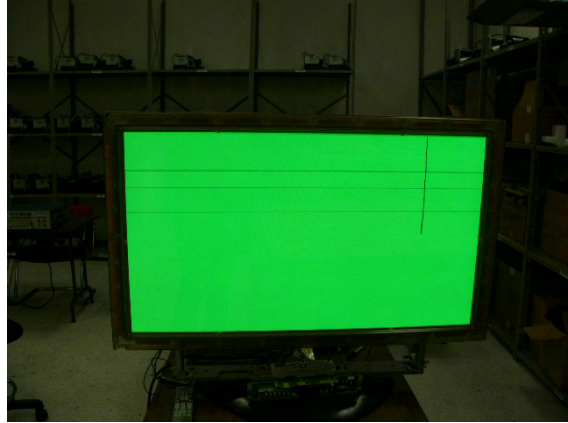


Figure 50

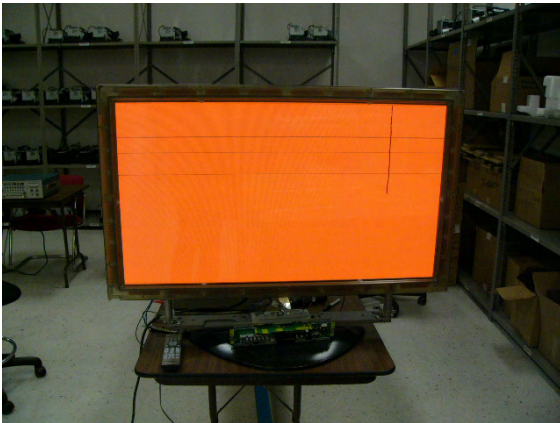


Figure 51

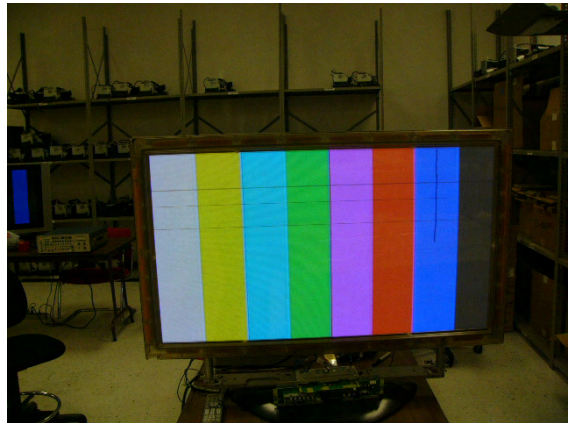


Figure 52

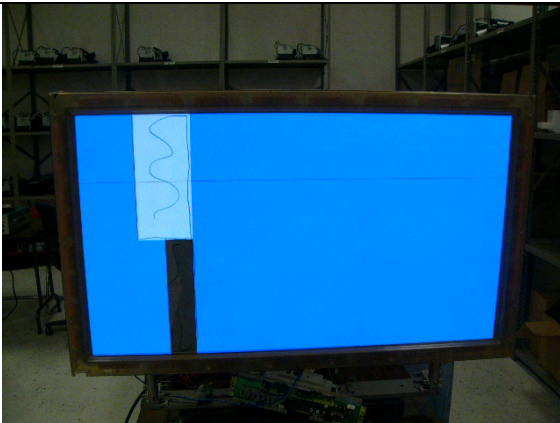


Figure 53

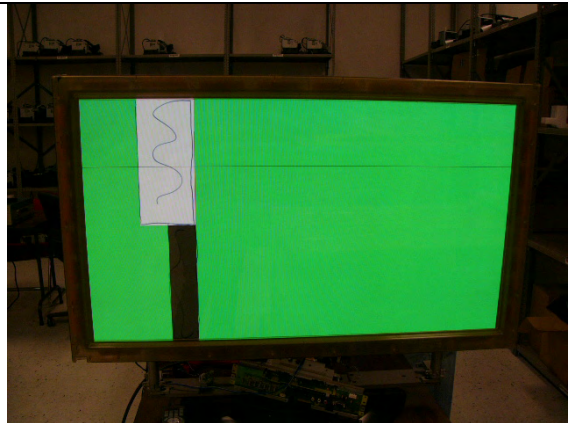


Figure 54

Table 9

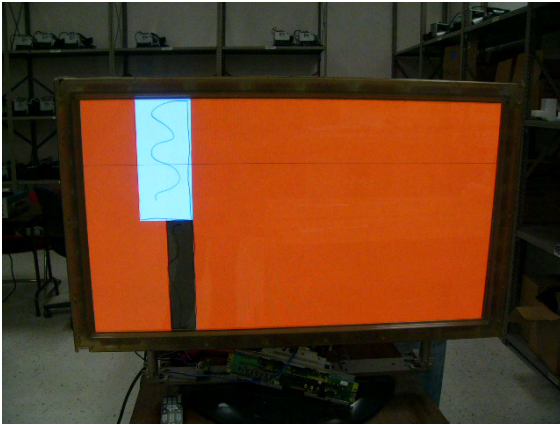


Figure 55

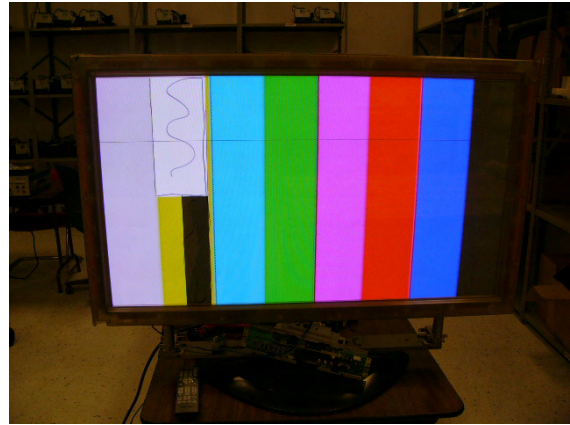


Figure 56



Figure 57



Figure 58

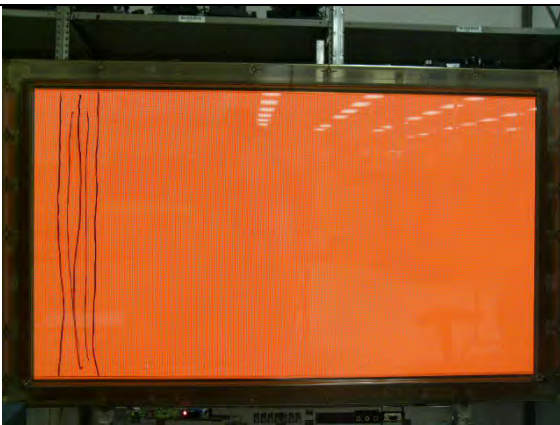


Figure 59



Figure 60

Table 10

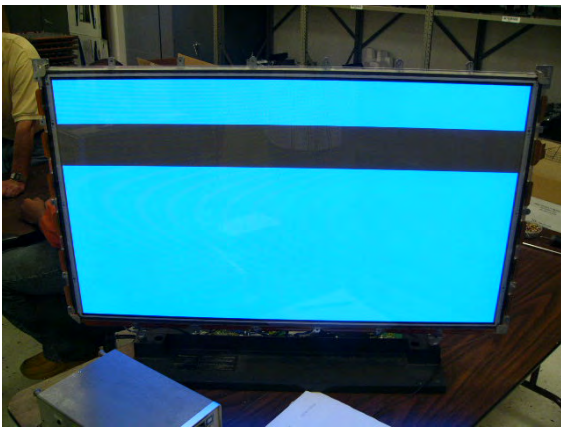


Figure 61

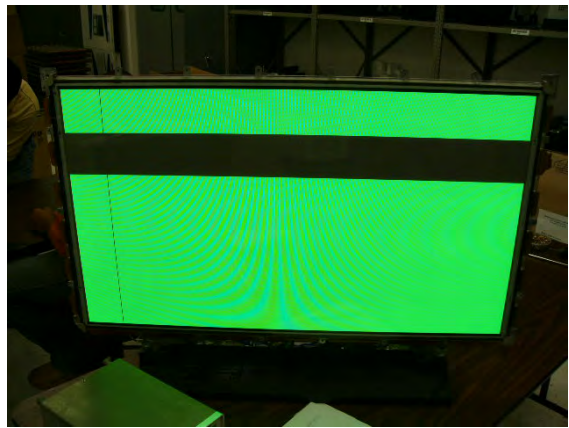


Figure 62



Figure 63

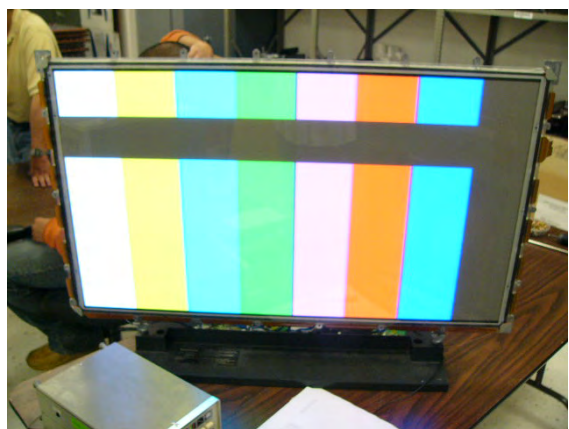


Figure 64

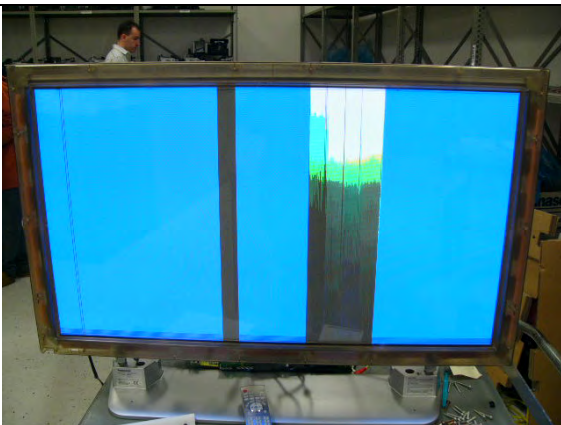


Figure 65

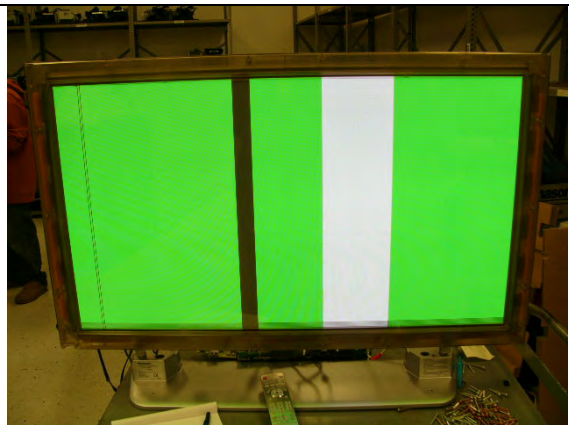


Figure 66

Table 11

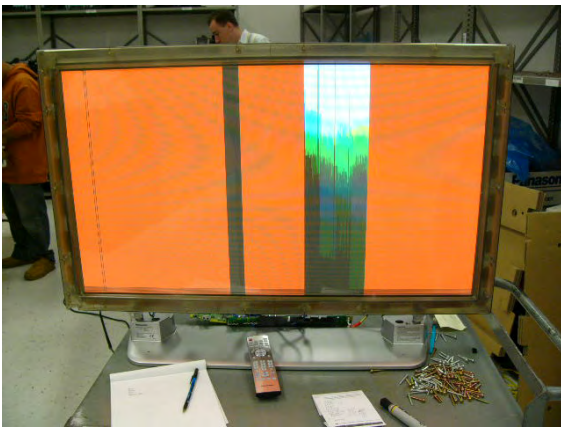


Figure 67

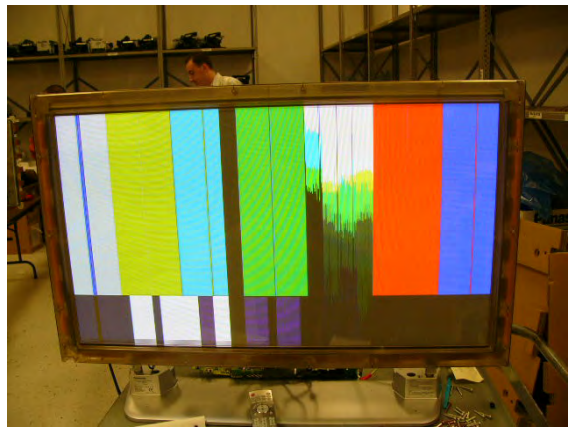


Figure 68

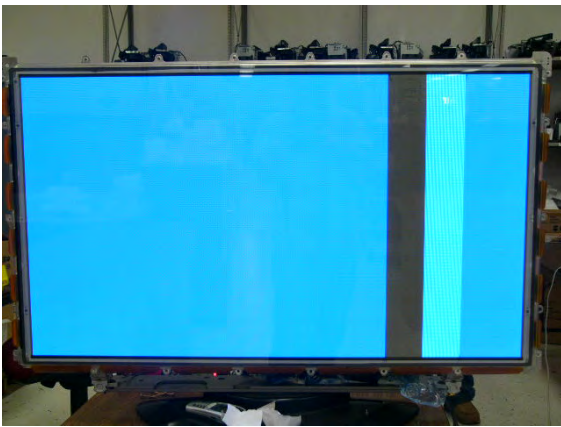


Figure 69

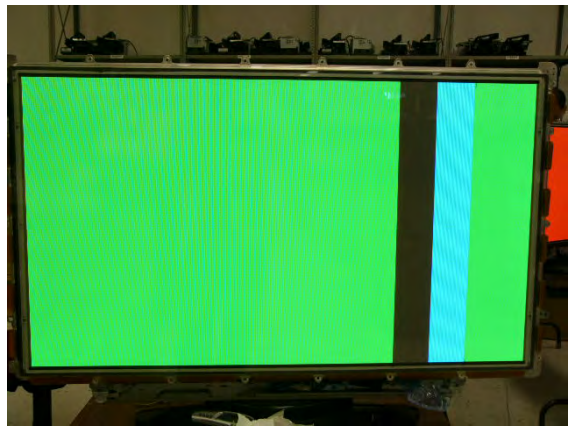


Figure 70

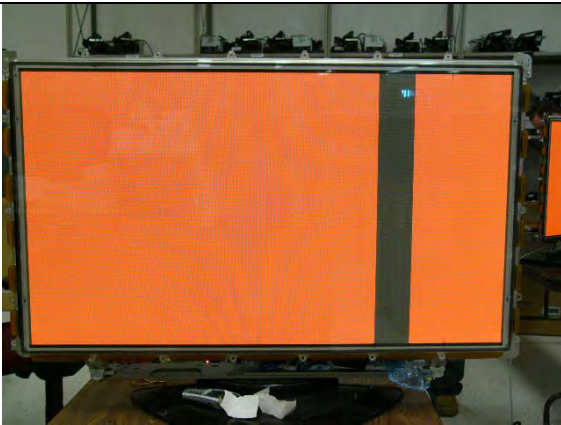


Figure 71



Figure 72

Table 12

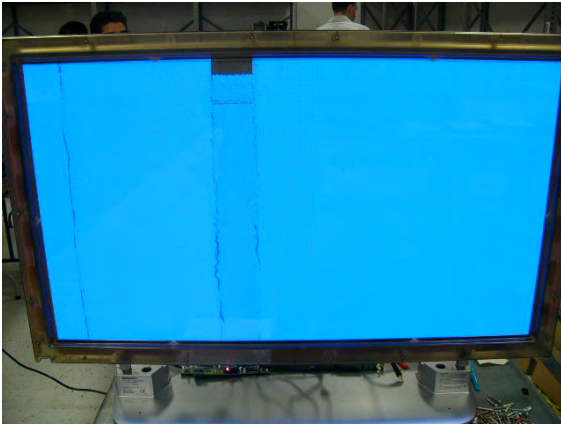


Figure 73

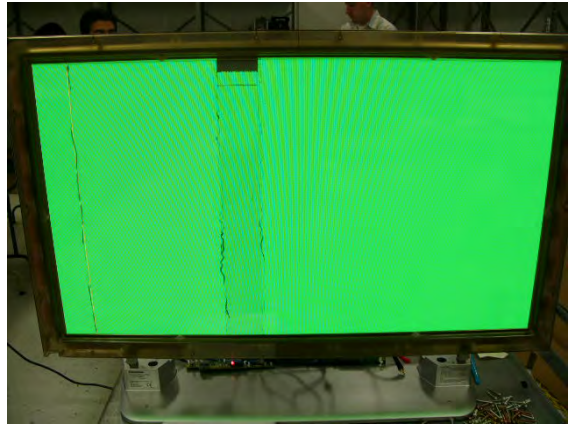


Figure 74

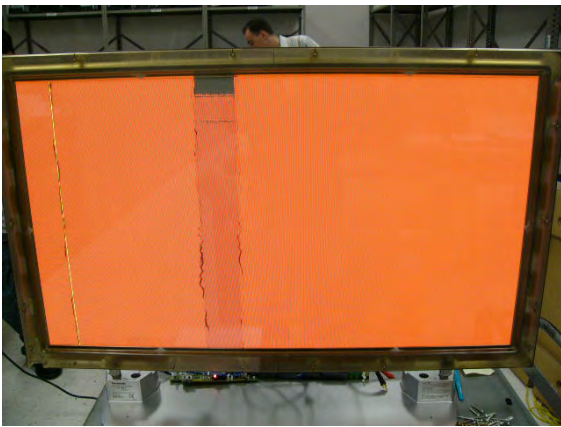


Figure 75

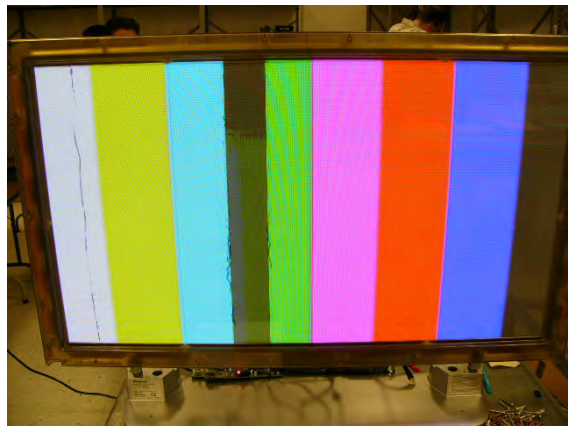


Figure 76

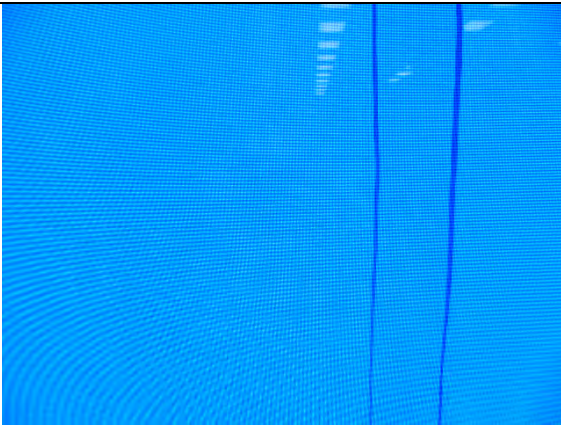


Figure 77



Figure 78

Table 13



Figure 79

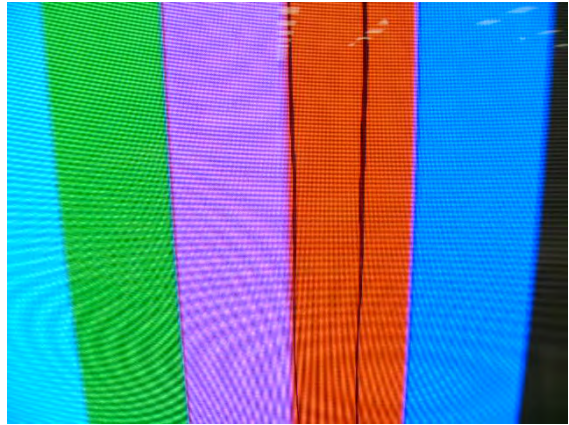


Figure 80

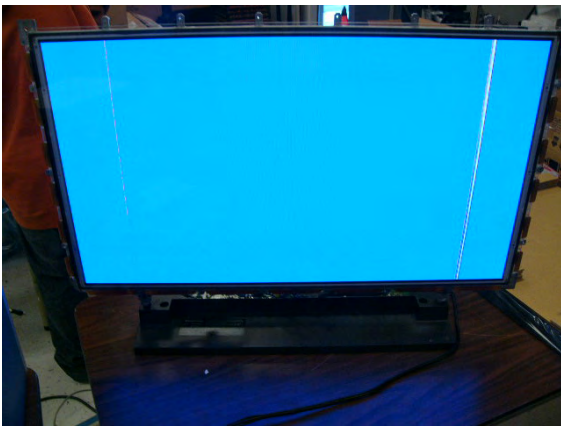


Figure 81

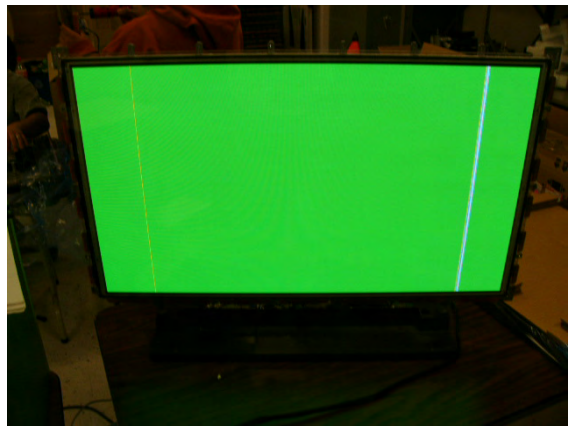


Figure 82



Figure 83



Figure 84

Table 14

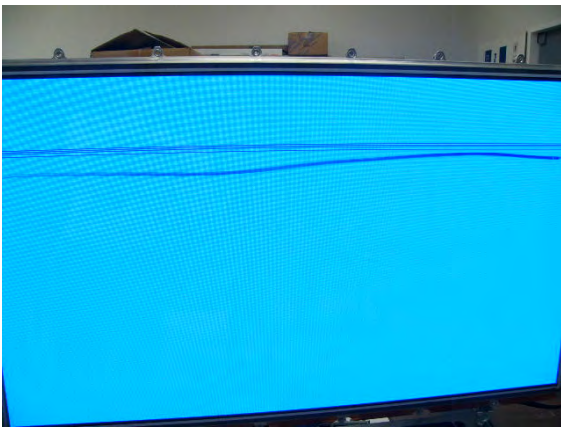


Figure 85

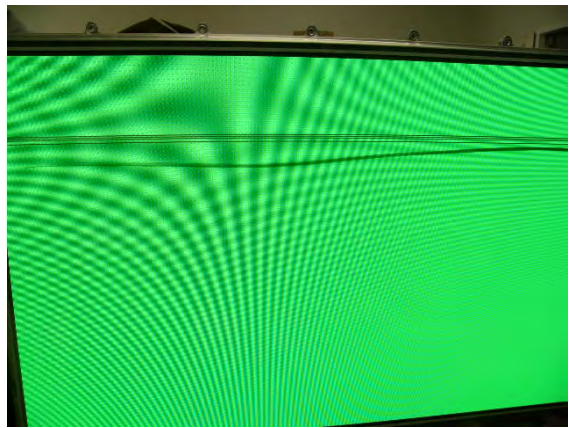


Figure 86

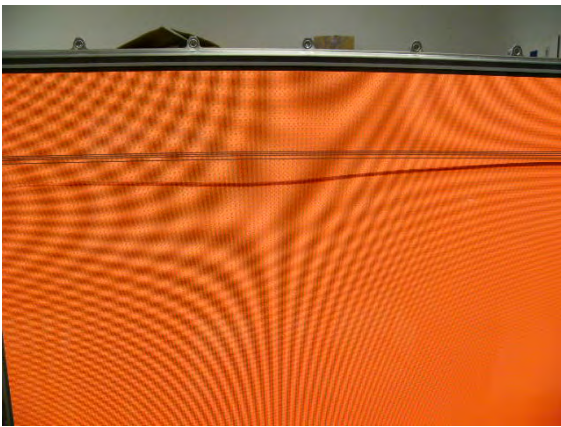


Figure 87

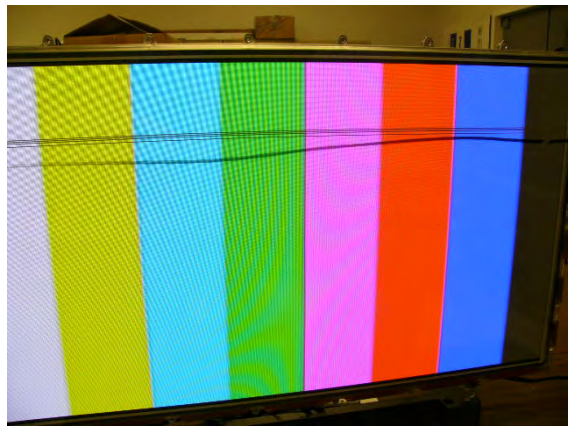


Figure 88

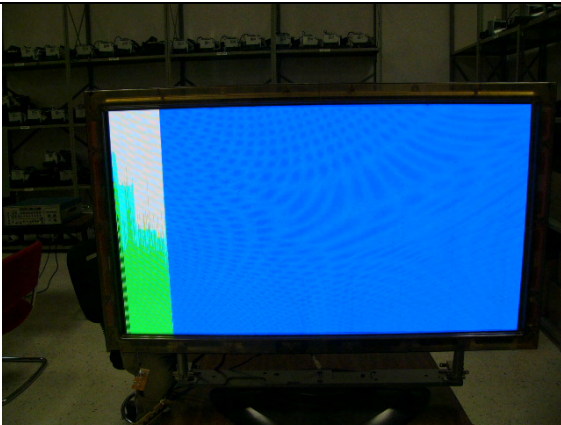


Figure 89



Figure 90

Table 15

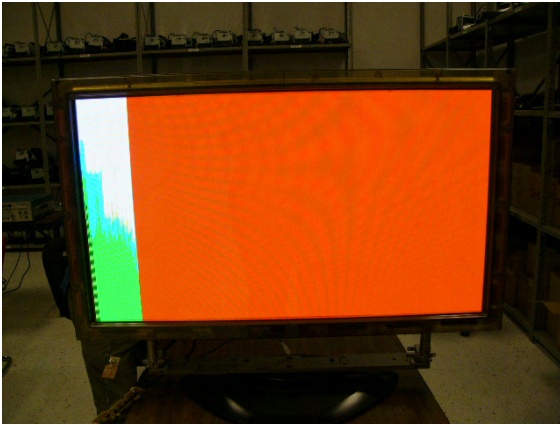


Figure 91

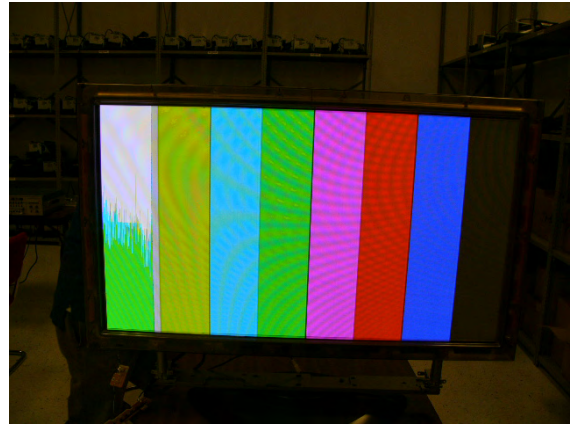


Figure 92

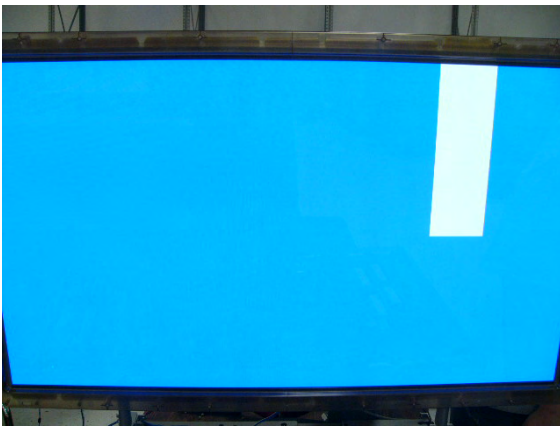


Figure 93

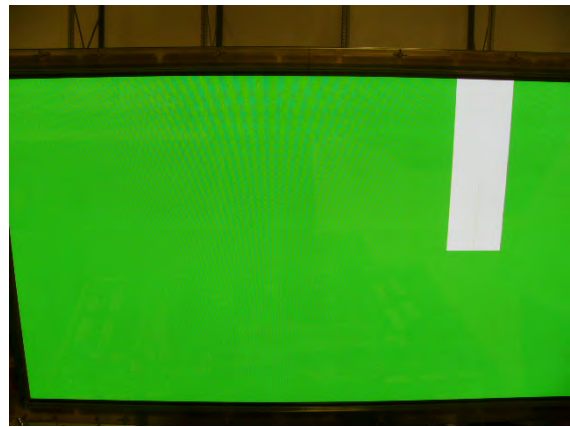


Figure 94

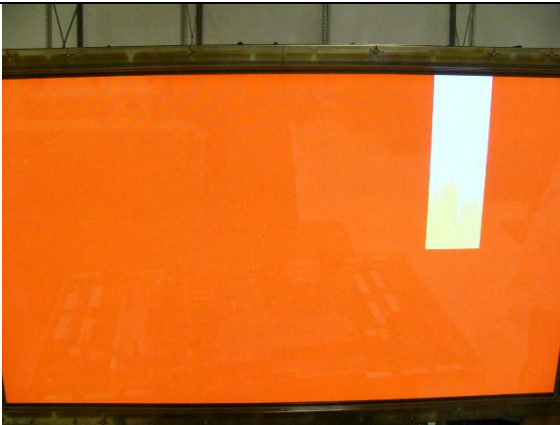


Figure 95



Figure 96

Table 16

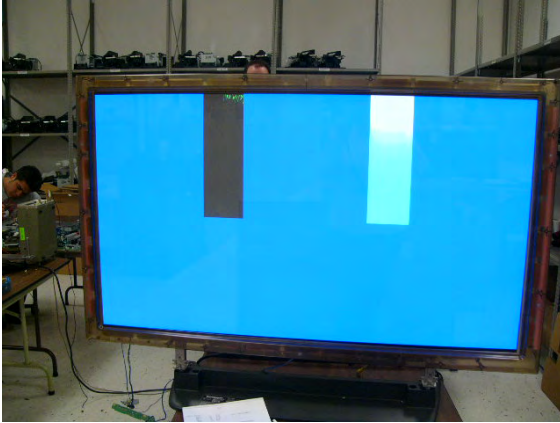


Figure 97

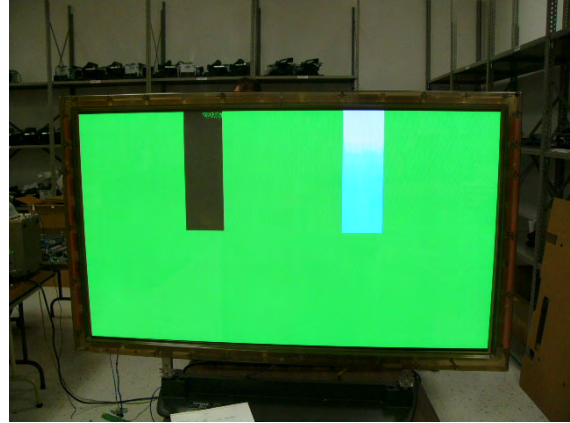


Figure 98

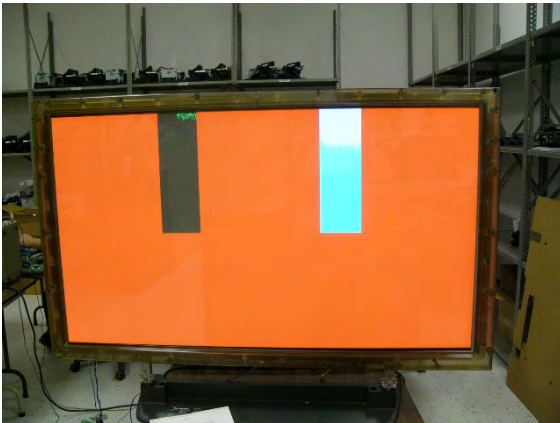


Figure 99

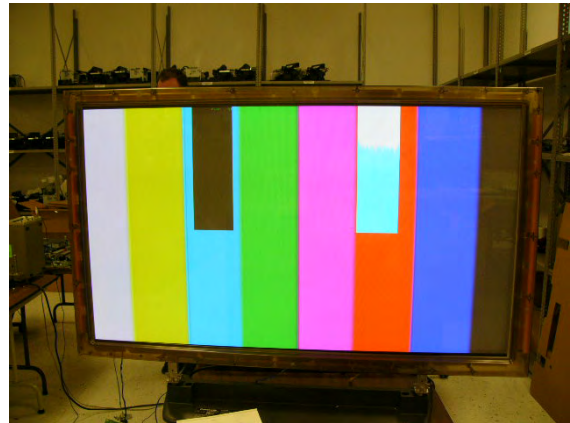


Figure 100

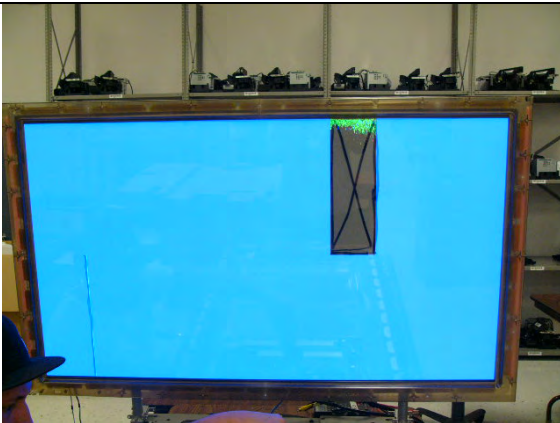


Figure 101

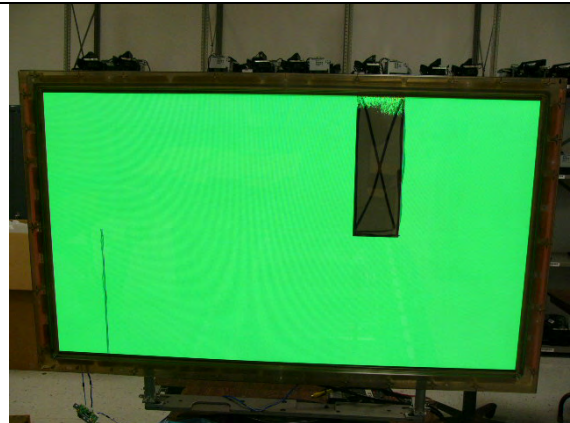


Figure 102

Table 17

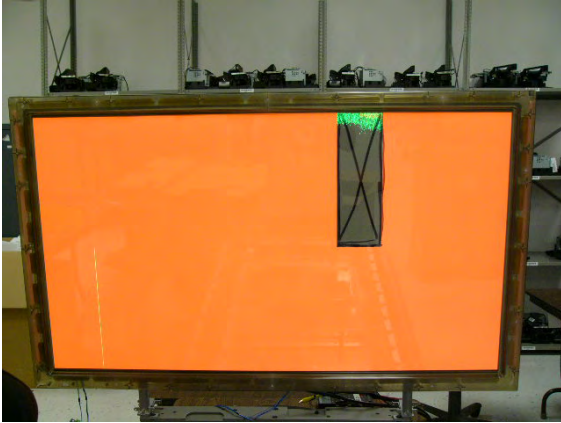


Figure 103

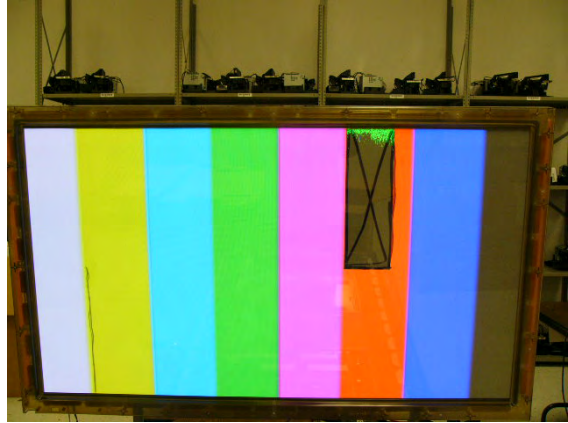


Figure 104

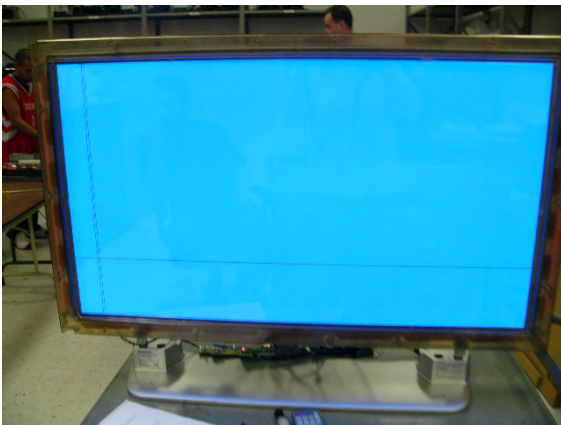


Figure 105

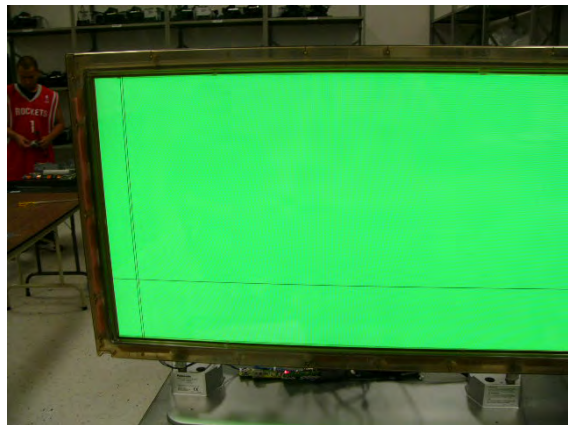


Figure 106



Figure 107



Figure 108

Table 18

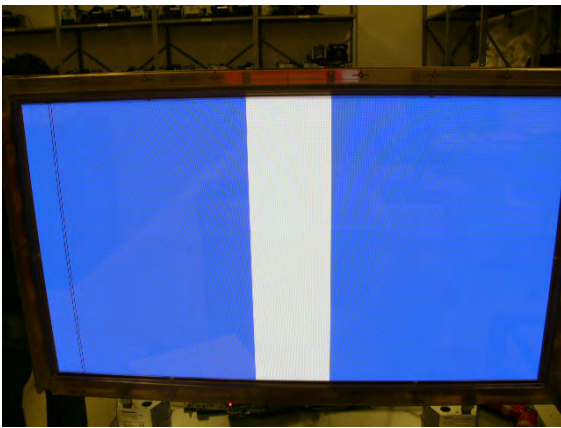


Figure 109

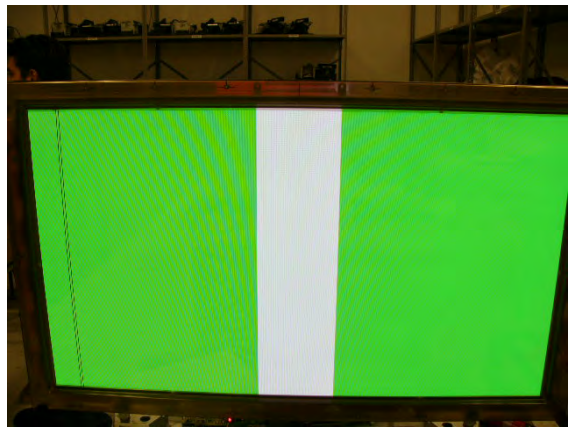


Figure 110

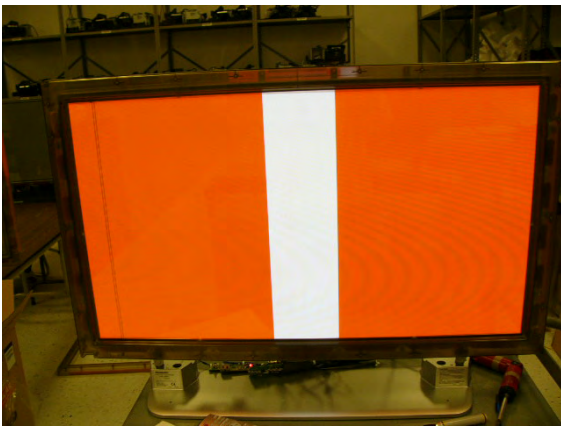


Figure 111

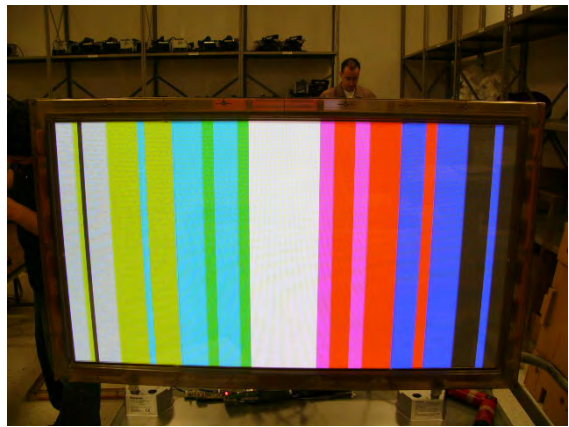


Figure 112



Figure 113

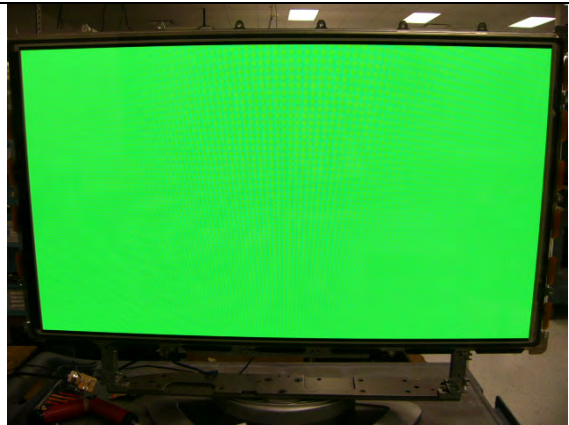


Figure 114

Table 19

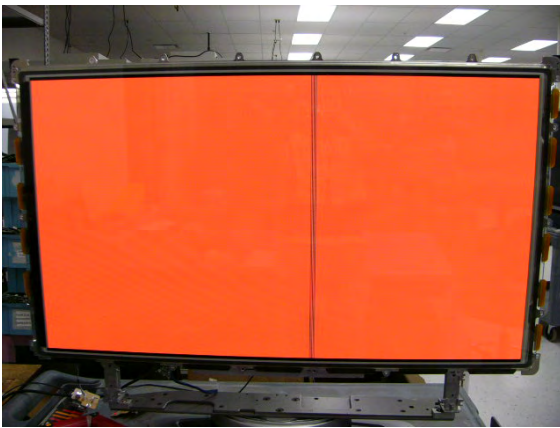


Figure 115

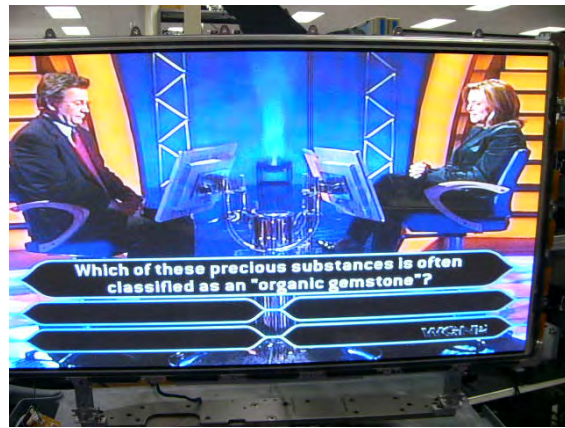


Figure 116



Figure 117



Figure 118



Figure 119



Figure 120

Table 20

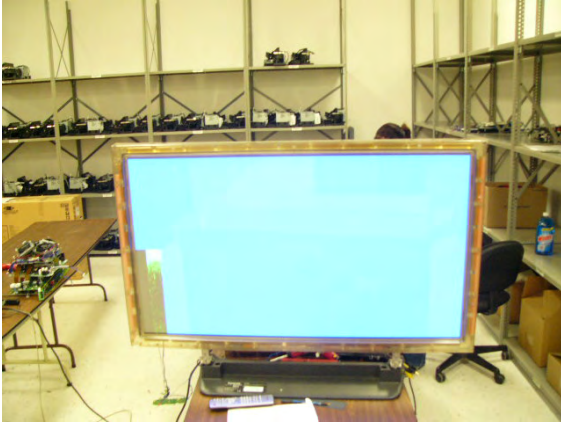


Figure 121

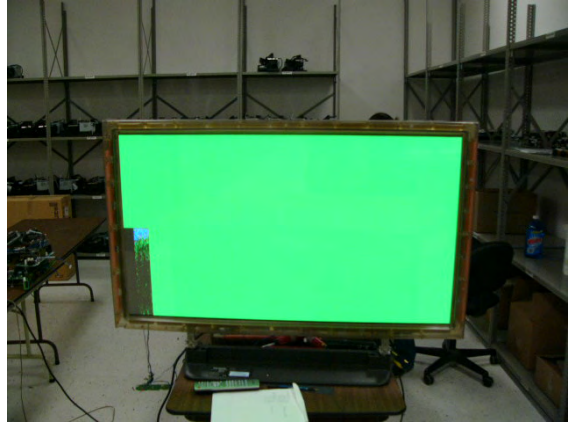


Figure 122



Figure 123



Figure 124

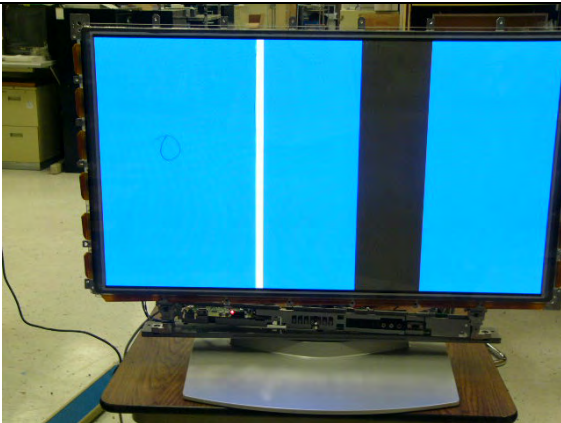


Figure 125

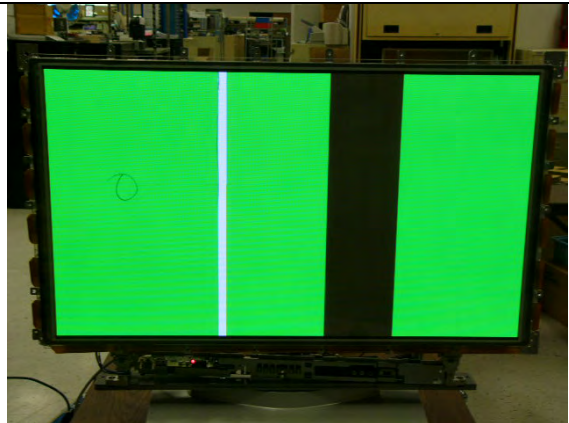


Figure 126

Table 21

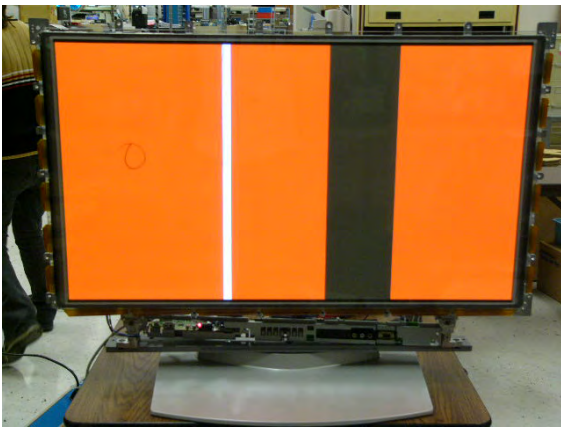


Figure 127



Figure 128

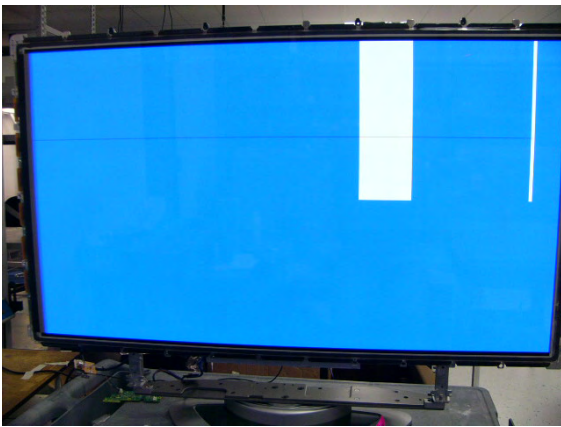


Figure 129

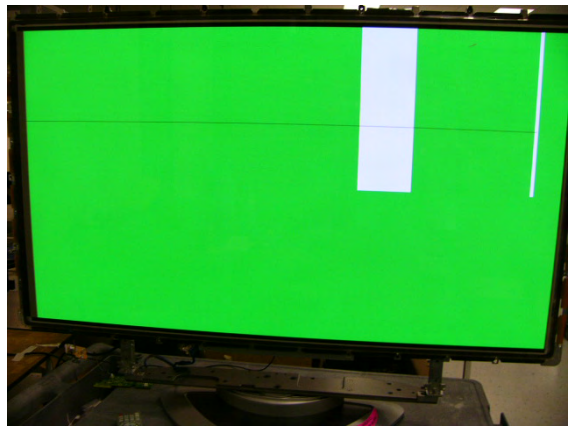


Figure 130

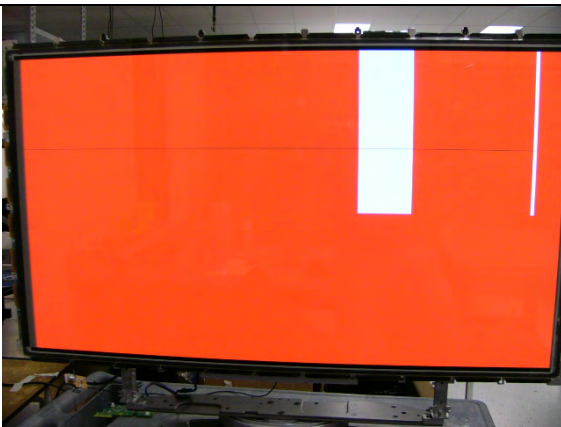


Figure 131

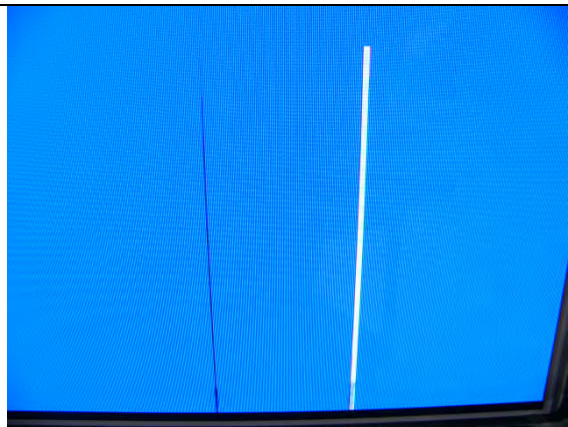


Figure 132

Table 22

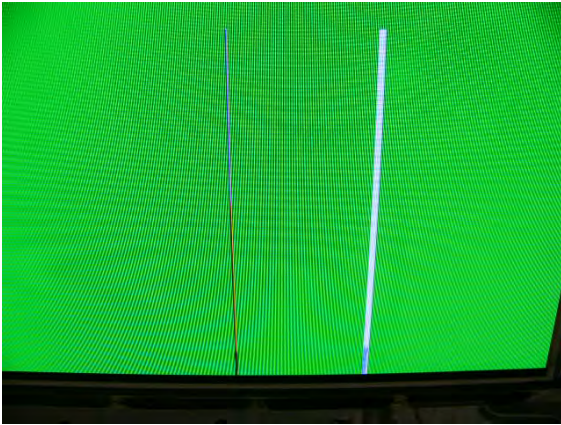


Figure 133

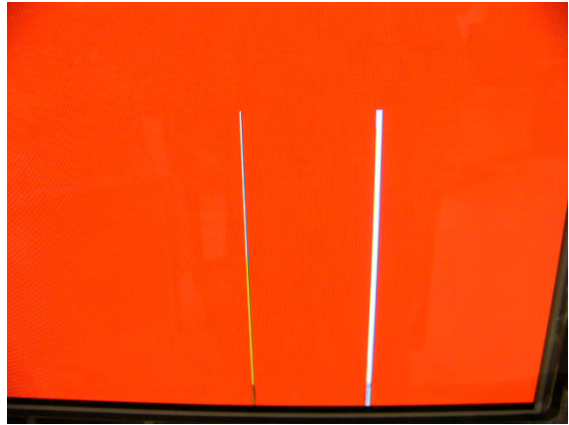


Figure 134

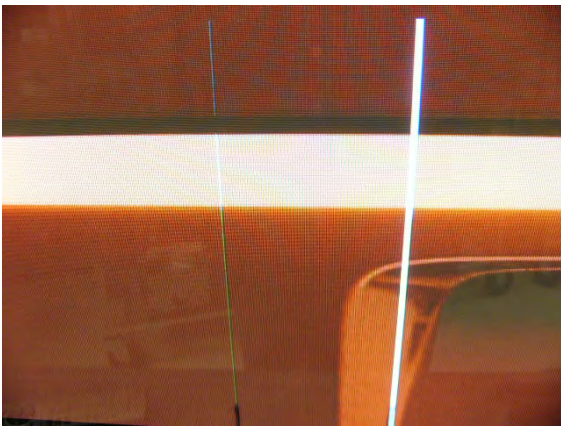


Figure 135

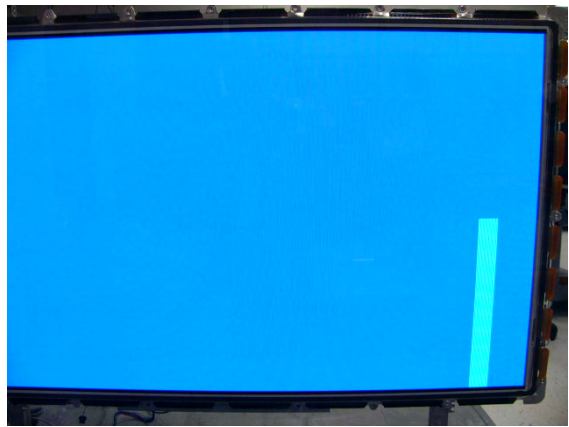


Figure 136



Figure 137

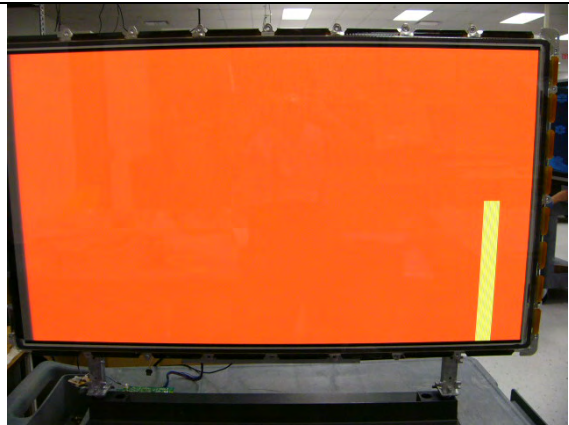


Figure 138

Table 23



Figure 139

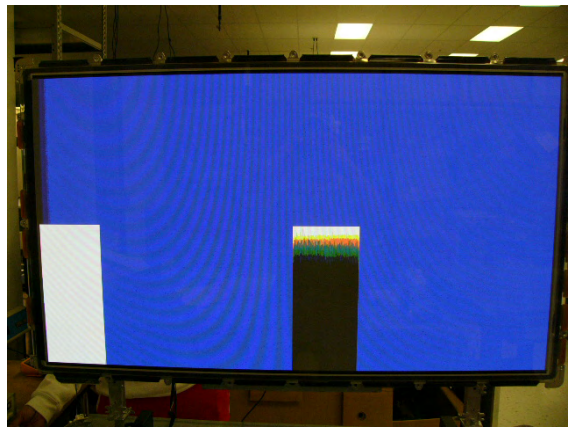


Figure 140

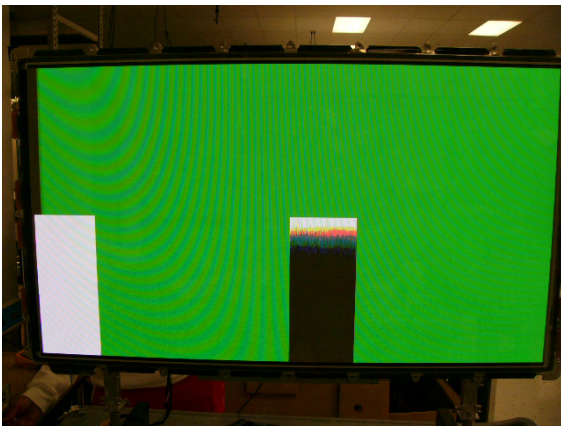


Figure 141

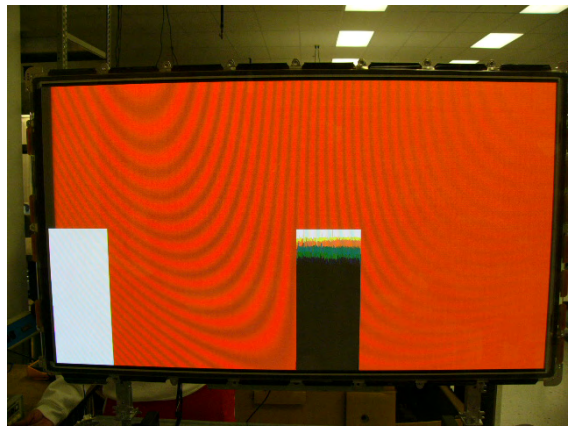


Figure 142



Figure 143

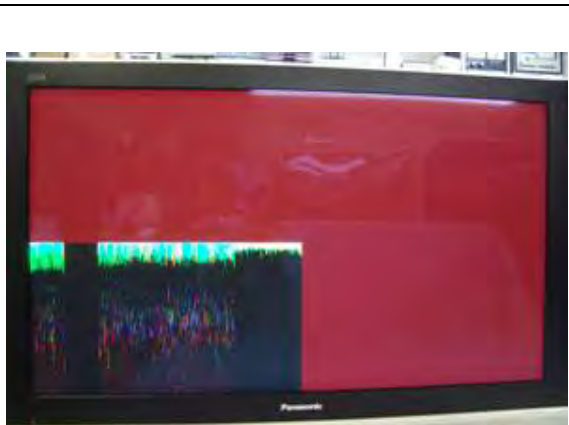


Figure 144

Table 24



Figure 145



Figure 146



Figure 147

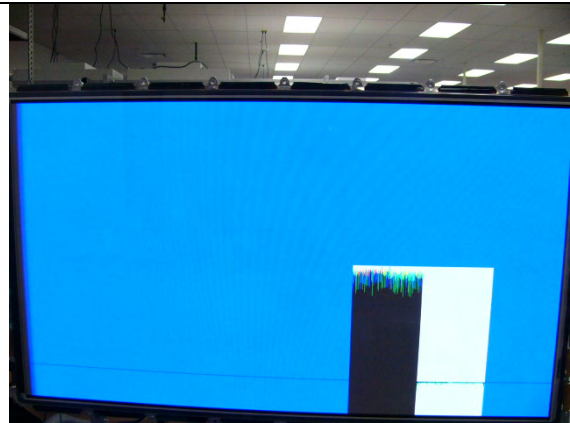


Figure 148

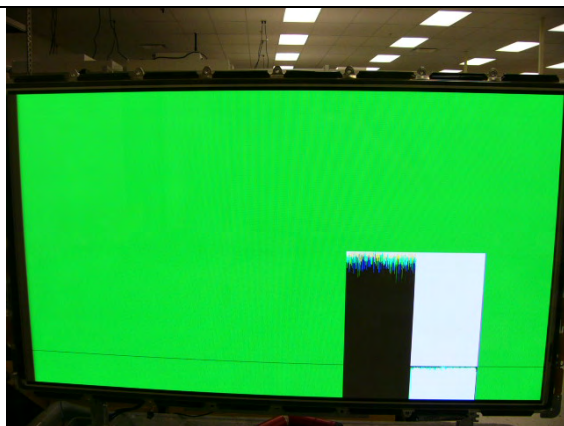


Figure 149



Figure 150

Table 25

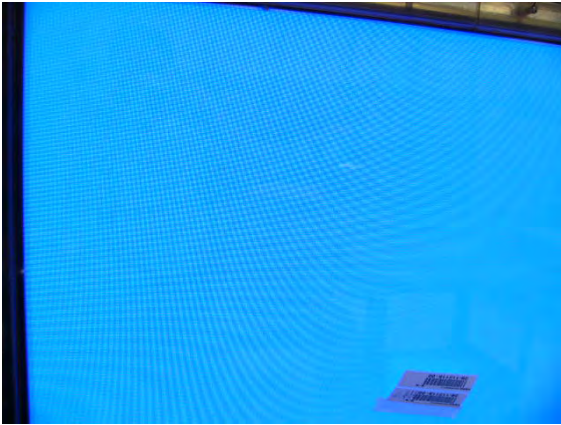


Figure 151

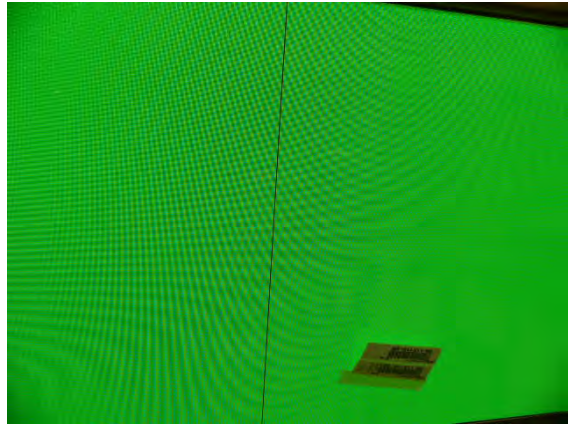


Figure 152

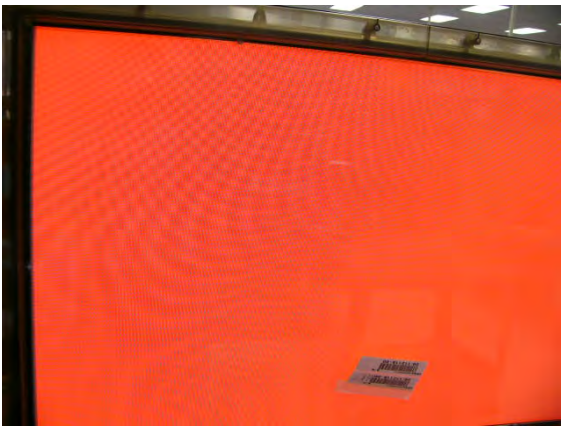


Figure 153

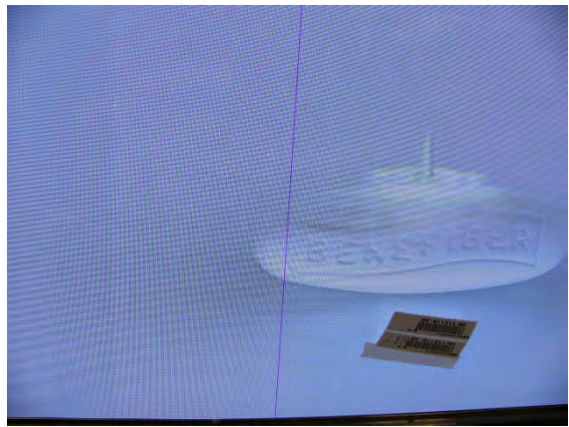


Figure 154

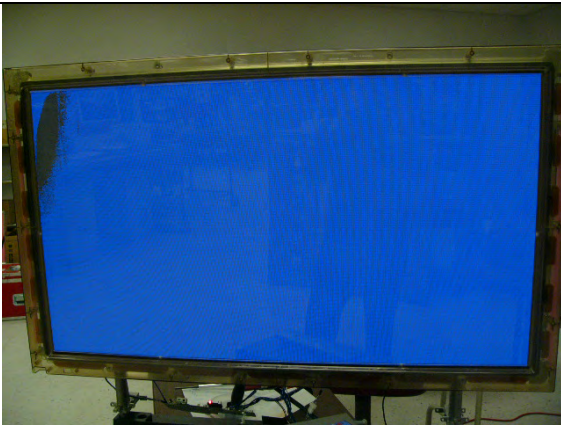


Figure 155

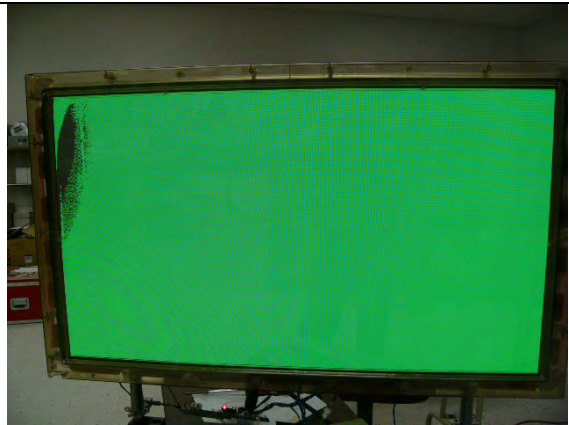


Figure 156

Table 26

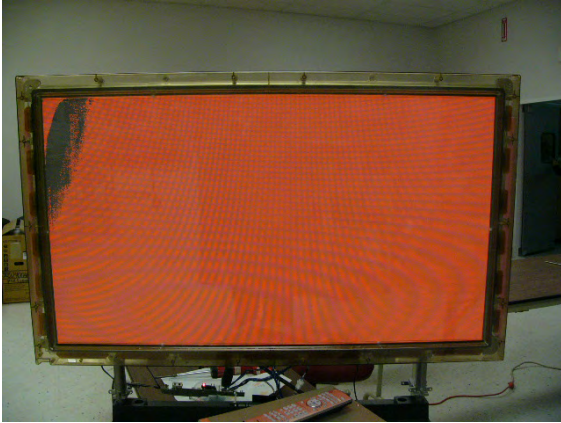


Figure 157

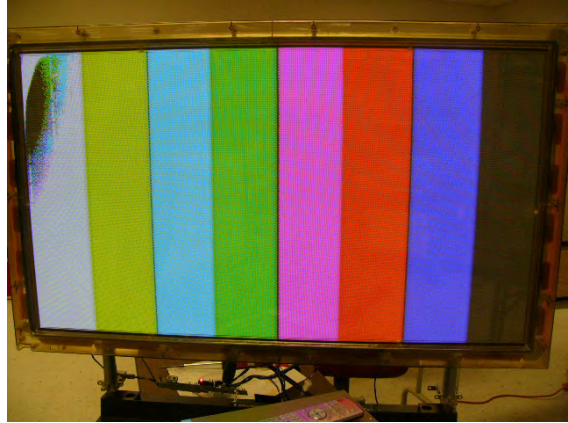


Figure 158

Table 27